



Sommario



On the first (1) and on the last (3) device of the chain, the termination resistances must be inserted. The cable shoes must be connected to ground by the fastons provided on the metal body.

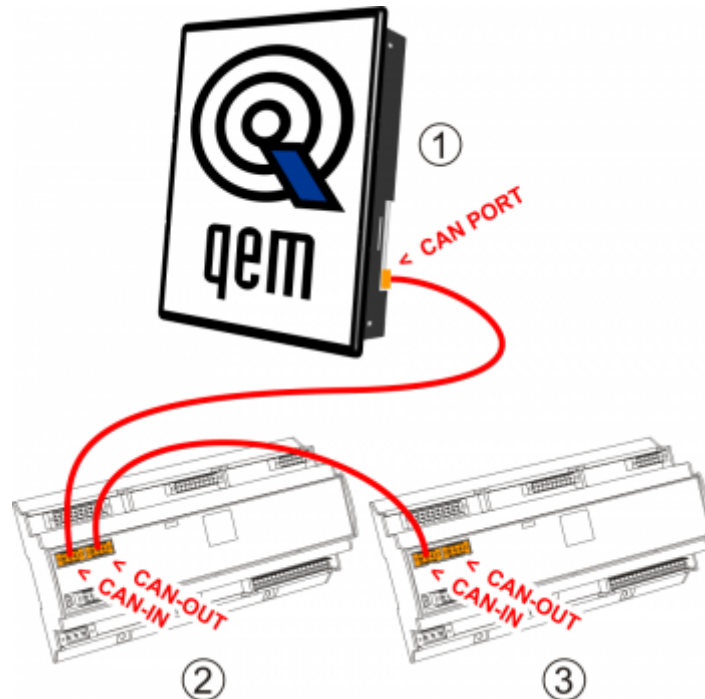

To activate the internal termination resistance see paragraph [Setup of CAN1 and CAN2 PORT Termination resistances](#)

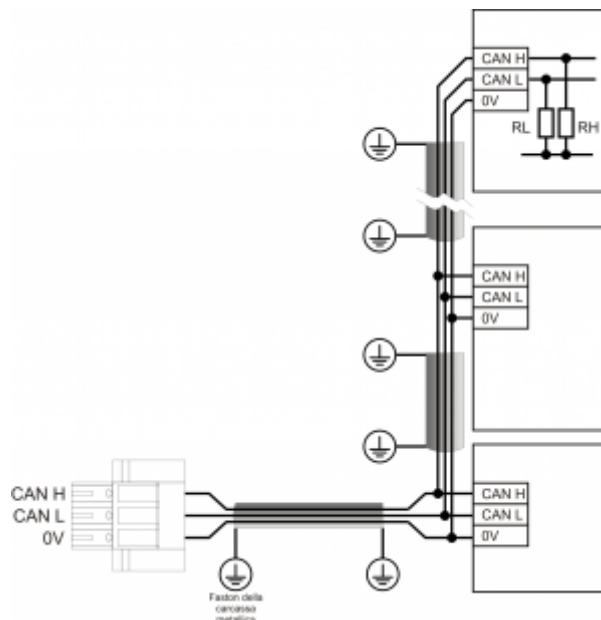

Caution: close the DIP JP1 and JP2 and insert the terminating resistors (RL, RH) on the last device in the chain.

Documento generato automaticamente da **Qem Wiki** - <https://wiki.qem.it/>

Il contenuto wiki è costantemente aggiornato dal team di sviluppo, è quindi possibile che la versione online contenga informazioni più recenti di questo documento.